

 Connection offline

### Technical product information

Transaction No.: **2016428/3**

Noises from driver storage compartment in dashboard - A8

Release date: 08-Jan-2010

### Customer statement / workshop findings

Noises from the driver side.

The driver storage box creaks.

### Technical background

The storage box touches the dash insert trim.

### Production change

Distance from storage box to dash insert trim increased through a cut-out section in the storage box.

From Chassis No. **4E7N019716**

### Measure

The following tool and materials are needed.

- Angle grinder.

Illustration 1 shows the affected component.



Illustration 1

Illustration 2 shows the point (see yellow circle) where the storage box touches the dash insert trim.



Illustration 2

Illustration 3 shows the area of the cut-out section (see yellow circle).

The cut-out section should be made with a small angle grinder.



Service number/damage code/manufacturer: 6816 / 020 / ...

**Accounting with APOS:**

Repair operations	Designation	Time units
68 18 19 00	Remove and install storage box under dashboard	50 TU
68 18 49 99	Modify storage box under dashboard	20 TU

**Accounting in APOS/2:**

Illustration	Position	Engine number	Activity	Time units
857-20	1	857005	19	See APOS/2
857-20	1	857005	50	20 TU

**Customer information**